



Tech Info Library

ImageWriter: Cleaning Guide Rails Solves Registration Problem

Revised: 12/17/87
Security: Everyone

ImageWriter: Cleaning Guide Rails Solves Registration Problem

=====

This article last reviewed: 1 December 1987

As ImageWriters and wide-carriage ImageWriters become older, the lubricants used on the carriage rails tend to dry up and prevent the carriage assembly from moving freely during printing. This can lead to unacceptable horizontal print registration: columns of characters don't line up properly from one line to the next, and appear to be shifted anywhere from one dot to half a character.

When this happens, thoroughly clean both guide rails with a degreasing solution and lint free cloth, then lubricate them. Clean the rail all the way around, not just the surface area visible from the top.

Tech Info Library Article Number:680