

ImageWriter II: Every Other Line Faded

Revised: 10/21/87 Security: Everyone

ImageWriter II: Every Other Line Faded

This article last reviewed: 12 October 1987

When an ImageWriter II prints correctly in one direction (either left to right, or right to left), but prints faded lines in the opposite direction, try replacing the ribbon wire and spring (935-0001). If the spring has been stretched slightly, the wire can slip on the pulley when moving in one direction. This prevents the ribbon from advancing and creates the faded lines.

Tech Info Library Article Number:893