



# Tech Info Library

## ImageWriter II: Faded Print Caused By Damaged Carrier Shaft

Revised: 10/21/87  
Security: Everyone

ImageWriter II: Faded Print Caused By Damaged Carrier Shaft

=====

This article last reviewed: 21 October 1987

If an ImageWriter II is dropped or handled roughly, the carrier shaft bushing may break, allowing the carriage to pull away from the platen on one side. Output looks fine on one side of the paper, but gradually fades out as it moves to the opposite side of the paper. Adjusting the paper thickness lever doesn't cure the problem.

The carrier shaft bushing may appear intact, but if you look closer, the two small dimples that the shims mount to are probably fractured or broken off. Replace the broken carrier shaft bushing (958-0006).

Tech Info Library Article Number:923