



Tech Info Library

ImageWriter II Problem/Cure: Prints Over Perforation

Revised: 11/10/88
Security: Everyone

ImageWriter II Problem/Cure: Prints Over Perforation

=====

This article last reviewed: 29 April 1988

PROBLEM DESCRIPTION: When printing to the ImageWriter II, the document seems to go to the next page, prints a few lines, then leaves about 3/4 to 5/8 inch of blank lines and then starts printing again. This condition gets worse as you print until the printer starts to print over the page perforation.

CAUSE: Switch 1-5 may be in the CLOSED position. This switch activates the PERFORATION SKIP function.

CURE: Turn the printer off. Put switch 1-5 in the OPEN position. Turn the printer back on.

Copyright 1988 Apple Computer, Inc.

Tech Info Library Article Number:1684