



Tech Info Library

EtherTalk 2.0: Needs AppleTalk Driver v53

Revised: 6/29/90
Security: Everyone

EtherTalk 2.0: Needs AppleTalk Driver v53

=====
This article last reviewed: 2 April 1990

INFORMATION -----

You may discover a compatibility problem with some networks (usually demonstration networks where many different types of software have been used).

The problem occurs when a server has first had EtherTalk 2.0, installed, then later has had EtherTalk 1.0 or 1.2 installed. AppleTalk driver version 53 -- which is installed with EtherTalk 2.0 -- does not work with earlier versions of the EtherTalk driver.

When switching from EtherTalk 2.0 to EtherTalk 1.0 or 1.2, AppleTalk driver v53 must be removed from the System Folder and replaced with AppleTalk driver version 52, which works with EtherTalk 1.0 and 1.2.

The removal must be done manually, by dragging the AppleTalk driver icon from the folder. Installing the new version can be done either with a Finder copy, or through the EtherTalk 1.0 Installer.

Copyright 1990 Apple Computer, Inc.

Tech Info Library Article Number:5445