



Tech Info Library

Network Software Installer Version ZM-1.4.5 Read Me (7/94)

Revised: 7/28/94
Security: Everyone

Network Software Installer Version ZM-1.4.5 Read Me (7/94)

=====
Article Created: 28 July 1994

TOPIC -----

This article is the Network Software Installer Version ZM-1.4.5 Read Me file.

DISCUSSION -----

You can use this Network Software Installer to install the following networking products:

- Update to AppleTalk version 58.1.4
- Network Control Panel version 3.0.2

- EtherTalk version 2.5.6
- Ethernet driver version 1.1.1 for the Apple Ethernet NB Card
- Ethernet driver version 6.0.5 for the Apple EtherTalk NB Card
- Ethernet driver version 1.1.1 for the Apple Ethernet NB Twisted-Pair Card
- Ethernet driver version 1.1.1 for the Apple Ethernet LC Card
- Ethernet driver version 1.1.1 for the Macintosh Quadra 700/900/950/800, Centris 610/650, built-in Ethernet port.
- Update to Ethernet driver version 1.1.1 for the Macintosh Quadra 610/650, built-in Ethernet port.
- Ethernet driver version 1.0.1 for the Macintosh Quadra 840AV and Centris 660AV
- Ethernet driver version 1.1.1 for the Apple Ethernet LC Twisted-Pair Card
- Ethernet driver version 1.1.1 for the Apple Ethernet CS Twisted-Pair/Thin Coax/AAUI Card

- TokenTalk version 2.5.6
- Token Ring Control Panel version 1.0.1
- Update to Token Ring driver version 2.5.2 for the TokenTalk NB Card
- Token Ring driver version 1.0 for the Token Ring 4/16 NB and Token Ring NB/c Card

In addition, this Installer installs the following related products:

- A/ROSE 1.2.1

This installer works on either System 6.0.5 or later, or System 7 Macintosh computers.

NOTE:

=====

On Macintosh computers with a 68040 microprocessor (Quadra, Centris, and Performa 470 series), some programs may quit unexpectedly or cause the computer to freeze when you attempt to open them over the network. This problem, as well as others, is fixed by installing the System Update 3.0 available from AppleLink or the Internet (<ftp.apple.com>).

Restrictions:

=====

You must use the Installer application (version 3.4.3) included on this floppy disk. Any other version of the Installer application will not perform a correct installation for this product.

Note that the "NSI International Files" folder is not empty; it contains invisible files necessary for the installation.

This software should not be installed with AppleTalk Internet Router and AppleShare client on a Macintosh with only 1 Megabyte of memory.

The new token ring driver is not compatible with MacIPX versions 1.1 and older. Contact Novell Technical Support to obtain an update to newer MacIPX software which will work with this token ring driver.

SoftWindows versions 1.0 and 1.0.1 using SMB (NetBEUI) protocols to access Lan Manager servers over Token Ring are not 100% compatible with the AppleTalk version included on this disk. Contact Insignia Solutions regarding availability of an update to the SoftWindows software which will work with this driver.

If this release of the Network Software Installer is being used in conjunction with an Apple Internet Router v. 3.0 Installer, Router 3.0 must be installed first. This will ensure that the Router installation does not overwrite the newer AppleTalk software contained on NSI 1.4.5.

To use this release of the Network Software Installer with a SNA•PS gateway, a special custom install option is provided that installs a compatible token ring driver for the Token Ring 4/16 NB card. SNA•PS gateway is not currently supported on the TokenTalk NB or Token Ring NB/c cards. A future version of the SNA•PS gateway will not require the custom-installed driver.

Release notes for each item follows:

AppleTalk version 58.1.4

=====

The LAP Manager was fixed to avoid sending corrupted TEST and XID response packets in certain heavy traffic situations.

Apple Token Ring NB driver file version 1.0

=====

This token ring driver file handles all Apple Token Ring cards for the NuBus - the TokenTalk NB, Token Ring 4/16 NB and Token Ring NB/c. The file is installed into the extensions folder. The new driver for the Token Ring 4/16 NB and Token Ring NB/c cards has significantly better performance and fewer problems in large source-routed environments than earlier drivers.

Built-in Ethernet driver for Quadra 610 and 650 version 1.1.1

=====

An installation problem prevented an earlier fix for QuickTime performance from working on these machines. This installer correctly updates the driver on these machines to improve QuickTime performance over built-in Ethernet.

Support Information Services

Copyright 1994, Apple Computer, Inc.

Tech Info Library Article Number:15916